

Service

BULLETIN #110

SEPTEMBER 5, 1990

PAGE 1/1

MODELS AFFECTED

P-38

SUBJECT

ROCKER COVER LEAKAGE

A recent design change by Cummins on rocker cover gaskets for 88NT engines, has resulted in possible top end engine leaks when used with model P-38 PACBRAKE housing.

The limited sealing surface on Cummins gasket part #3067460 does not provide adequate width to mate with the top of model P-38 housings.

Use the PACBRAKE laminated cork gasket part #P08532 or equivalent.

Pacbrake Service

PACBRAKE[®]
ENGINE & EXHAUST BRAKES