

Service

BULLETIN #153

FEBRUARY 2001

PAGE 1/1

MODELS AFFECTED	P-80
SUBJECT	IMPROVED MASTER PISTON RETAINER


Pacbrake engineering has released an improved master piston retainer for use on model P-80 engine brakes. The improved retainer uses the same part number as the original, as it is a direct replacement. Two versions of the early retainer exist, a single fastening hole and a dual fastening hole.

Engine brake housing serial numbers 080000 to 088088 require the single screw hole retainer P/N P80017 and housing serial numbers 088089 to current require the dual screw hole retainer P/N P80024.

A bridge between the two legs identifies the improved retainer. (See illustration below).

Parts orders will be filled with the improved retainer and any inventory of the obsolete retainers may be returned to the factory for replacement with the improved type.

This is a product improvement not subject to campaign.

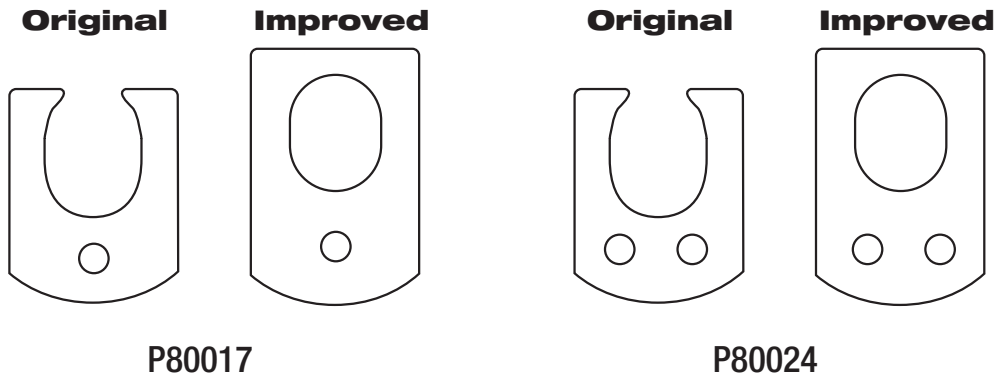

PACBRAKE[®]
ENGINE & EXHAUST BRAKES